



CITY: Highlands Ranch DIV/GROUP: GIS DB: BG  
 Project (Project #):  
 Path: G:\GIS\ASARCO\_ElPaso\GIS\MXDR\Revised\Revisions Oct 2014\Fig 4-20 Arsenic Soil Locations PBA2.mxd Date: 10/10/2014 Time: 11:39:15 AM

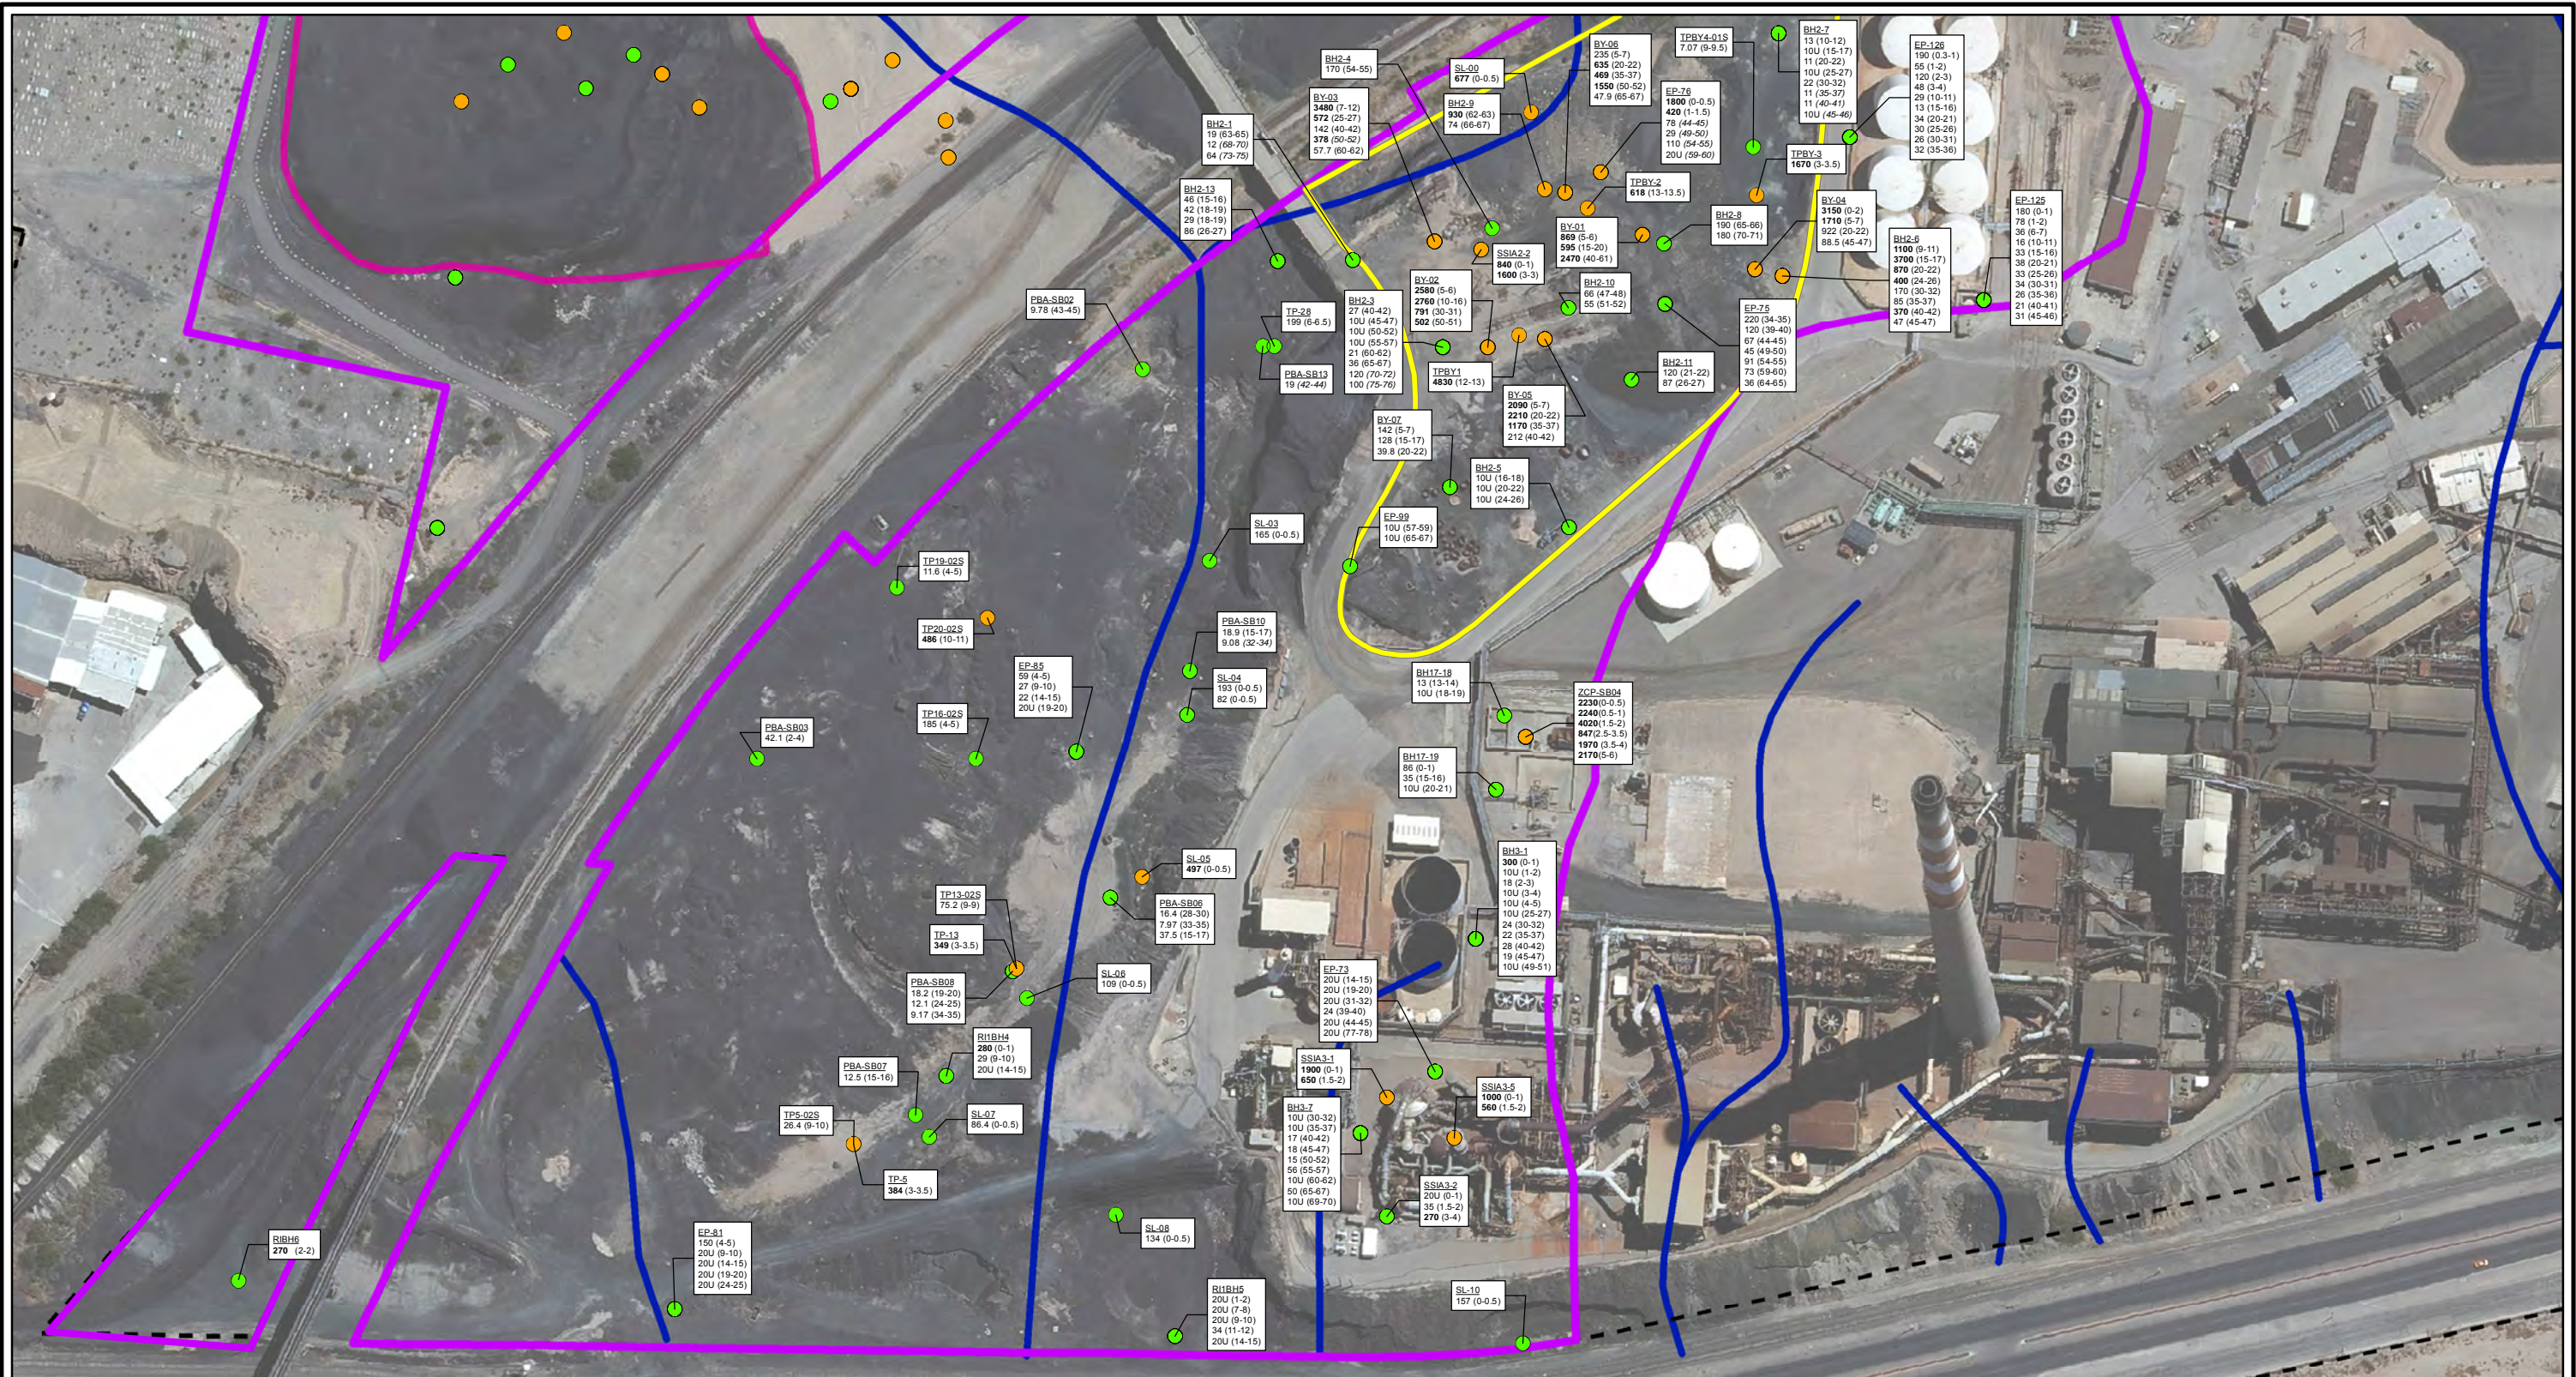

- LEGEND:**
- DETECTED ≤ SCREENING LEVEL
  - DETECTED > SCREENING LEVEL
  - HISTORICAL ARROYO TRACE LINES
  - AREA BOUNDARY
  - FINES PILE BOUNDARY
  - BONEYARD BOUNDARY
  - PROPERTY BOUNDARY

**NOTE:**  
 Screening Level (RRR SAI-Ind = 320 mg/kg)  
**Bolded Value** exceeds screening level  
*Italics* indicate below the water table  
 J = Estimated Value  
 U = Not detected at or above reporting limit  
 Date of Aerial Photo: 2009

Sample ID  
**SL-07**  
 86.4 (0-0.5)  
 Depth (ft bgs)  
 Arsenic Concentration in mg/kg

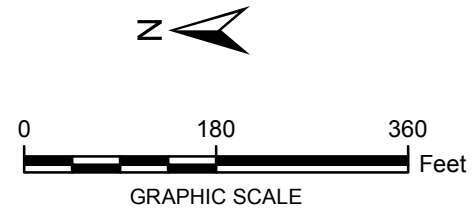

FORMER EL PASO SMELTER SITE  
 EL PASO, TEXAS

**ARSENIC DISTRIBUTION IN SOIL  
 PARKER BROTHERS ARROYO/BONEYARD**

**FIGURE  
 4-20**

**MALCOLM  
 PIRNIE**